
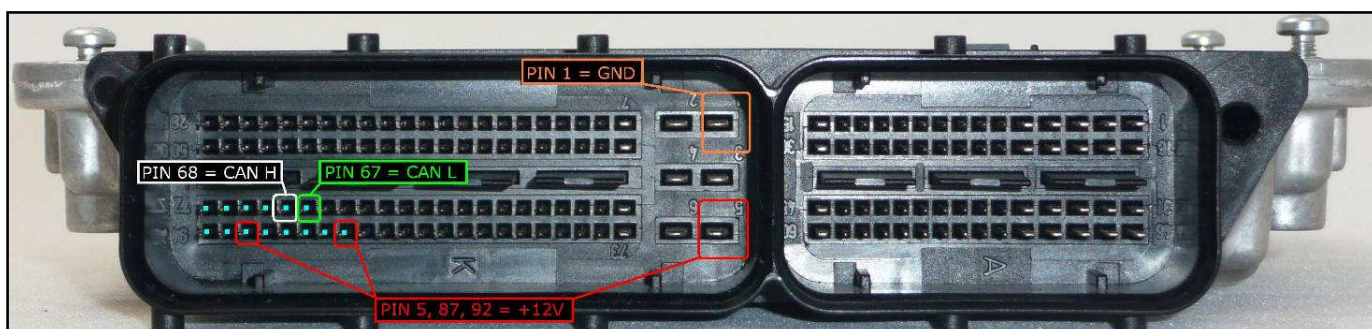
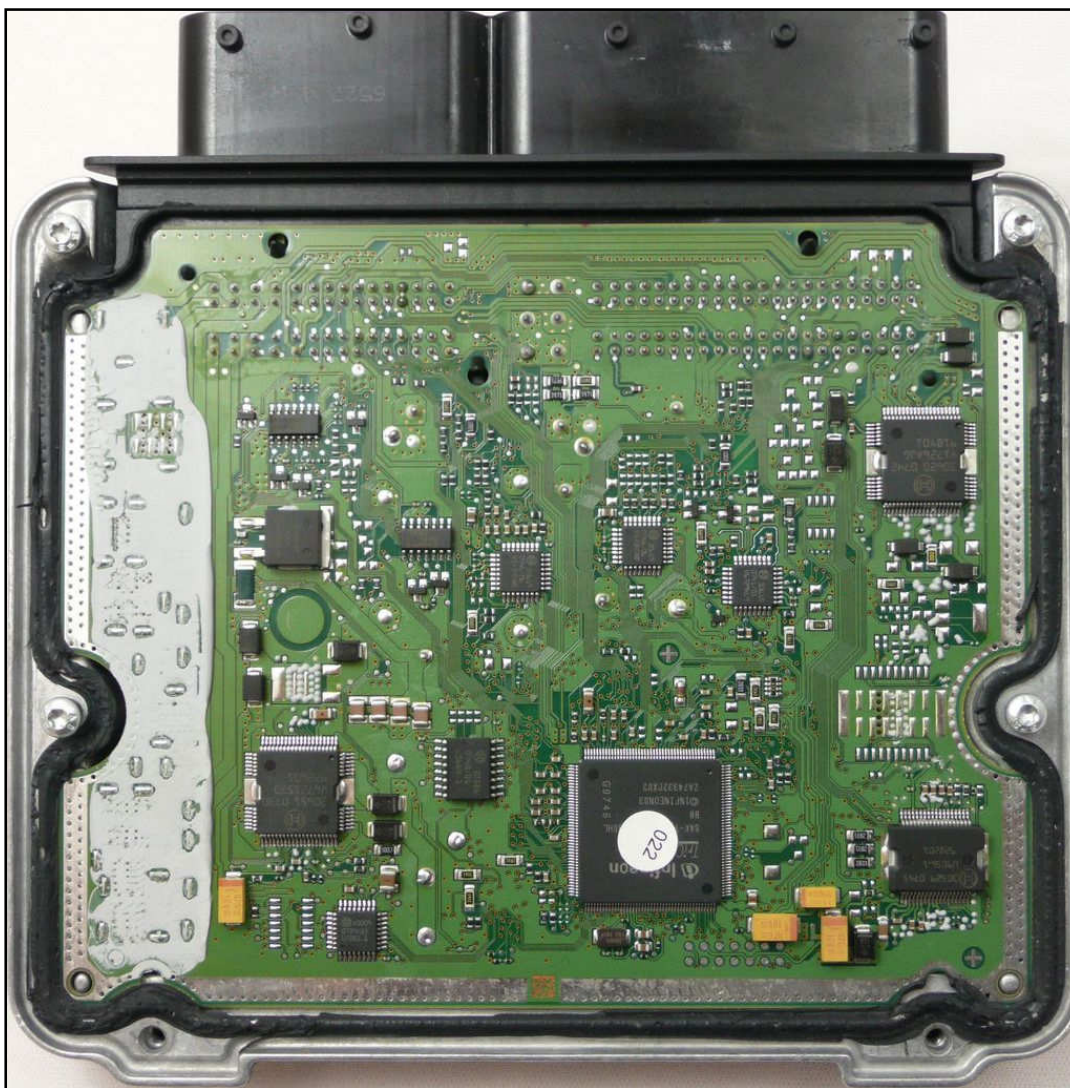


PLUGIN 128

On this ECU it is possible ONLY the DIRECT CONNECTION. It is NOT possible the DIMA CONNECTION because there are NOT the three essential power lay-by-pins.

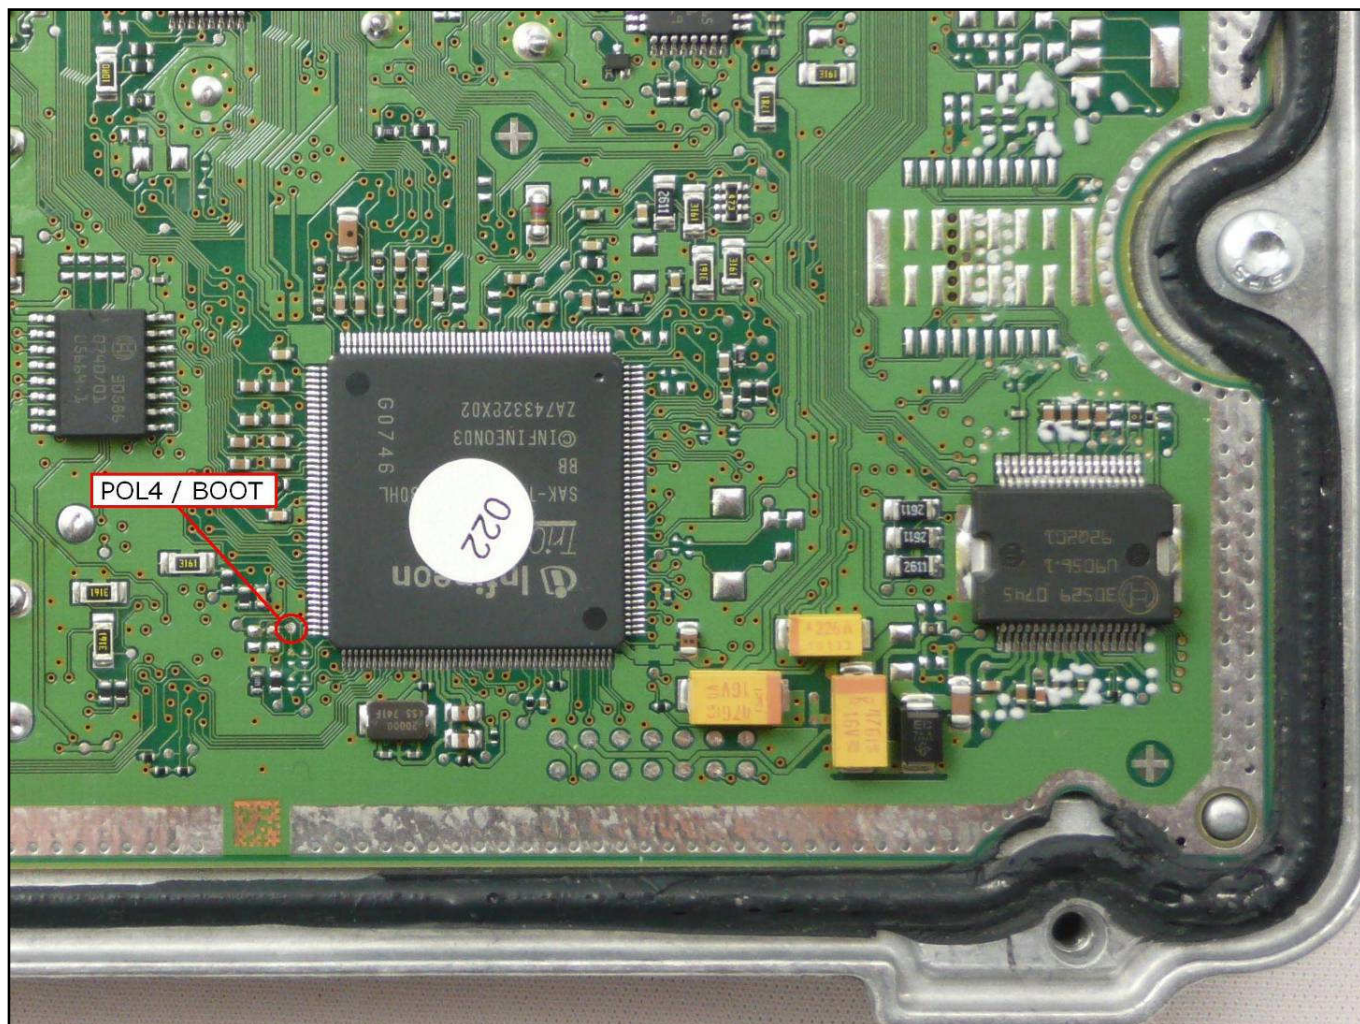

DIRECT CONNECTION**MED17.5**

MED17.5.5